



TR-Series

User Manual



TR-100 (100g x 0.01g)

TR-600 (600g x 0.1g)

TR-Series


Thank you for purchasing the Fast Weigh MS-600 digital pocket scale. Please read all operating instructions carefully before use. Scales are precision measuring devices and should always be handled with proper care. To ensure years of reliable service, keep these simple tips in mind:

- Do not exceed the scale's maximum capacity. Overloading your scale can permanently damage it!
- Avoid exposure to extreme heat or cold. Scales perform best at normal room temperature. If temperatures have changed dramatically, calibration and adjustment may be necessary.
- Allow your scale to warm up for 30-60 seconds before performing calibration and adjustment(if available).
- Store your scale in a clean, dry location. Dust, dirt, and moisture can accumulate on the weighing sensors and electronics causing inaccuracy or malfunction.
- Avoid using your scale in close proximity to strong radio wave emitting devices such as computers, cash registers, and cordless phones.
- Always weigh on a flat and level surface, free from vibrations and drafts. The corner of a room is usually the most stable.
- Gently apply all items to be weighed. Do not drop items onto the weighing platform.
- Avoid dropping your scale. The warranty does not cover damage due to rough treatment or overload.
- Check the batteries first if you are having any trouble with your scale. This simple step can remedy most scale issues.
- Do not disassemble your scale. This product contains no user serviceable parts.

I. Part List


1. Scale
2. Cover / Weighing Tray
3. AAA Batteries (x2)

II. Key Description

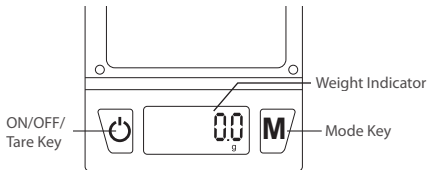



III. Battery Installation

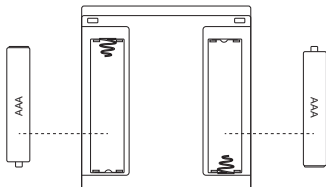1. Before using the scale for the first time, check the battery compartment and remove any plastic insulation strips or packaging that may be in place to prevent battery drainage during shipping/storage.
2. If you are replacing the batteries, make sure the positive and negative contacts are properly aligned.



IV. Operation


1. Place the scale on a flat, level surface and press the  key to turn the scale on.
2. Once the start-up process completes and the scale goes to zero you are ready to weigh.
3. Place the quantity to be weighed onto the weighing platform.
4. Wait a couple seconds for the display to stabilize before taking a weight reading.
5. To turn the scale off, press and hold the  key.

V. Changing the Unit of Measure


1. Press the **M** key to change the scales displayed unit of measure.
2. If the scale is turned off then back on, it will default to the last unit used.
 - **TR-100 Units:** g (gram) ▶ oz (ounce) ▶ ct (carat) ▶ gn (grain)
 - **TR-600 Units:** g (gram) ▶ oz (ounce) ▶ ozt (troy ounce) ▶ dwt (pennyweight)

VI. Using the Tare Feature

You can use this scale's tare feature to subtract the weight of an empty container or vessel for net weight determination. NOTE: The weight of the container will subtract from the available capacity.

1. Place the empty container or vessel on the weighing platform.
2. Tap the  key once. The display will then reset to zero. If the container is removed, it's weight will be displayed as a negative number.
3. You may now fill the container with the quantity to

be weighed. The display will show the net weight of the contents.

4. To return to normal weight display (gross weight), remove any items from the weighing platform and tap the  key again to re-zero the scale.

VII. Calibration

Calibration and adjustment are performed at the factory. However, the weighing range can shift slightly during shipping. Also, due to changes in local acceleration of gravity around the world, adjustment is recommended when moving the scale from one location to another. To check calibration:

1. Place the required calibration weight on the scale and note the displayed value.
2. If the displayed value is not within acceptable tolerance (see chart below), adjustment is required.

Model	Acceptable Tolerance (\pm)	Calibration Weight	Recommended Accuracy Class
TR-100	0.03g	100g	OIML M2
TR-600	0.2g	500g	OIML M2

VIII. Adjustment

1. Turn the scale ON.
2. Press and hold the **M** key until the display shows "CAL".
3. Press **M** again. The display will flash "CAL" followed by the required calibration weight (see above).
4. Place the required calibration weight on the platform.
5. The display will show "PASS" then return to normal weighing. Calibration is complete!

IX. Troubleshooting

- **Problem:** Scale will not turn on
- **Solution:** Check the batteries

- **Problem:** Displayed weight fluctuates randomly
- **Solution:** Make sure your workspace is stable and free of any air currents or vibration

- **Problem:** Displayed weight is inaccurate
- **Solution:** Perform a calibration adjustment

X. Error Codes

1. **OUTZ** - Zero range has shifted. Perform calibration adjustment. If the problem persists, the load cell may be permanently damaged due to overloading.
2. **UNST** - Scale is unstable. Use in a more stable position.
3. **HHHHH** - Maximum capacity exceeded. Remove the extra weight to avoid damaging the load cell.
4. **L** - Batteries are low. Replace the batteries.

XI. Specifications

	TR-100	TR-600
Max. Capacity	100g	600g
Readability	0.01g	0.1g
Min. Weight	0.03g	0.2g
Power	2 x AAA Alkaline Batteries	
Dimensions	0.8 x 2.4 x 3.8"	
Platform Dimensions	2.0 x 2.3"	
Warranty	5 Year Limited Warranty	

XII. Capacity/Readability Charts

TR-100
100g x 0.01g
3.527oz x 0.001oz
500ct x 0.05ct
1543.2gn x 0.2gn

TR-600
600g x 0.1g
21.16oz x 0.001oz
19.29ozt x 0.001ozt
385.8dwt x 0.1dwt